# BH Series 180mm CHART DOT-PRINTING TYPE HYBRID RECORDER



# MODEL BH 🗆 🗆

The BH Series hybrid chart recorders are easy to operate and use the reliable dot-printing method to record a variety of information in analog and digital formats on a 180mm wide chart.

Not only can each measured value be read from the custom made analog scale plate but a comprehensive LED display also enables precise digital measurements to be taken by the user.

The compact BH Series instruments have depth of only 195mm which makes them suitable for space sensitive installations including panel mounting.

#### **M** FEATURES

# · Ready to run immediately

As the recorders are pre-set to meet individual customer specifications and precise application requirements, the units start indicating and recording as soon as they are switched on.

Dual displays for accuracy and simplicity
 Measured values can be read at a glance, directly
 from maximum 6 multi scale analog display plate
 whilst a digital display clearly indicates measured
 values, alarm settings and chart speed together
 with a range of other information.

# · Compact and easy to install

The BH recorders are designed for use in applications where space is at a premium. With a reduced depth of 195mm and weighing 7.0kg, the instruments are ideally suited for panel mounted installations.


#### · Abundant functions installed

An abundance of easy-to-use functions including skip function, digital recording, year/month/day printing and key lock are installed. A variety of options including high-speed-dotting, external drive and alarm output are prepared to meet every requirements.


#### · Input signal shift function

Shift correction of indications can be done every point according to the sensor input signals. The indication and recording scale positions can be corrected.

Conforms to CE-marking

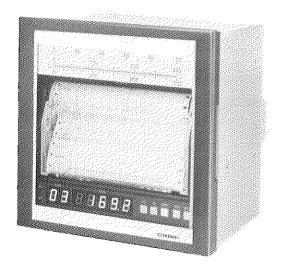


# MODELS

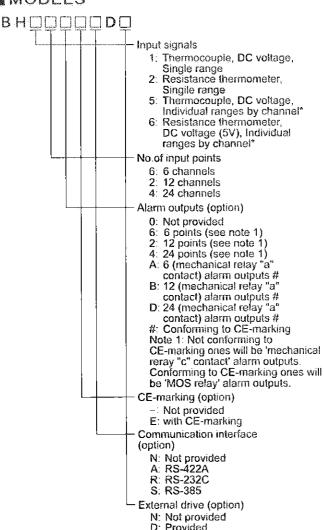

\* For the combinations by channels, refer to the reference measuring range.

# **MANAMES AND FUNCTIONS OF COMPONENT PARTS**

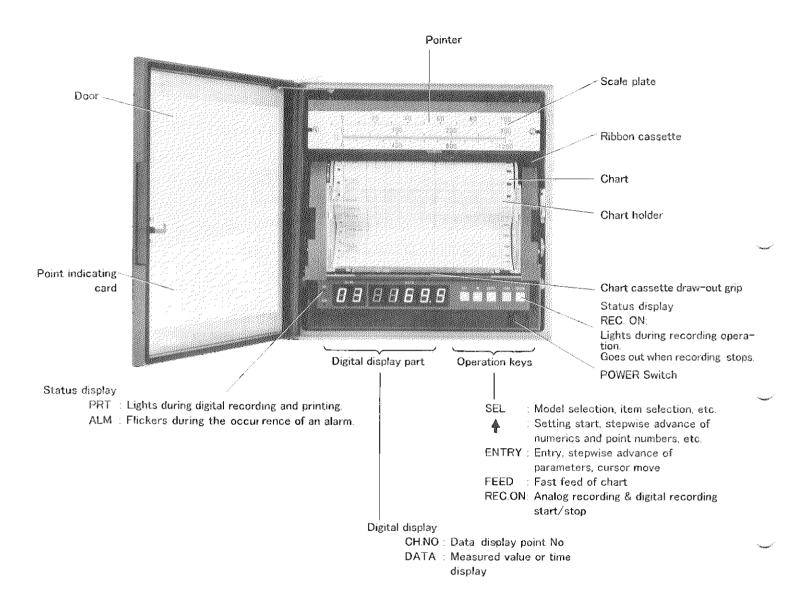




# **M** RECORDING FORMAT


# · Fixed time digital printing

Time, scale, chart speed, setting change mark, and hour lines are printed on analog recording at optional time intervals together with data recording.

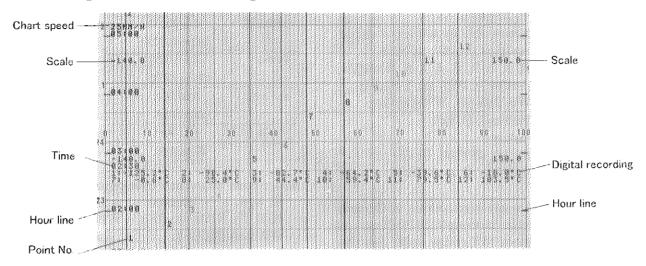


# · Instantaneous digital recording

When the latest data are necessary, analog recording is interrupted at once to record these data.

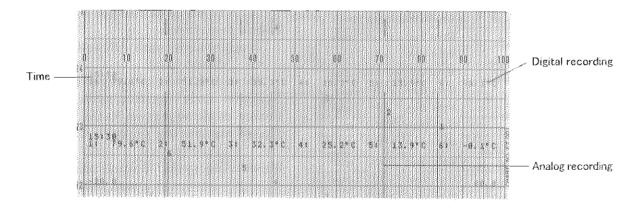

# ·Printing of occurrence and reset of alarms

Time, point No., alarm type, and level are printed when an alarm occurred and the alarm was reset.

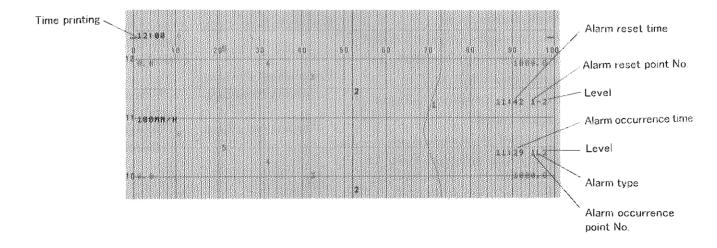

# **M** GENERAL SPECIFICATIONS

Input signals:

DC voltage ......  $\pm$  7mV,  $\pm$  14mV,  $\pm$  25mV,

 $\pm$  70mV,  $\pm$  5V

DC current ...... Applicable by adding a shunt

resistor (100 $\Omega$ , 250 $\Omega$ )

Thermocouple ..... B, R, S, K, E, J, T, N, Ni-NiMo, AuFe-Cr, PR5-20, PR20-40,

WWRe5-26, WWRe0-26, Platinel, U. L

Resistance thermometer

........... Pt100, JPt100, Pt-Co

Specify from the standard scale table every input point.

(These input signals are combinable with each other in case of the thermocouple/DC voltage, or resistance thermometer/5V range only. See the reference setting range.)

Max. 6 multi scale plate is available.

Scale: Specify the scales within the minimum setting range.

Reference measuring range	Minimum measuring range
7.0mV range	More than 3.2mV span
14.0mV range	More than 6.3mV span
25.0mV range	More than 11.3mV span
70.0mV range	More than 31.5mV span
5.0V range	More than 2.3V span
120 Ω range	More than 20.0Ω span
140Ω range	More than 20.0Ω span
160Ω range	More than 27.0Ω span
220 Ω range	More than 54.0Ω span
340 Ω range	More than 108.0 Ω span

\*The reference voltage input is 0 mV (0V), while the reference resistance input is  $100 \Omega$ .

\*See the reference setting range.

Accuracy rating: Digital indications and printing Thermocouple, resistance thermometer

......  $\pm$  0.3% of the scale range  $\pm$  1 digit. When the scale range less 300°C, accuracy rating is  $\pm$  1°C.

DC voltage.....  $\pm$  0.1% of the reference measuring range  $\pm$  1 digit

Analog indication ......  $\pm$  0.5% of the scale range

\*Note: Accuracy at a room temperature of  $23\%\pm2\%$ 

\*Note: For thermocouple inputs, the reference junction compensating accuracy is excluded.

\*Exceptional setting of accuracy rating

	0	J. C. C.
Input type	Scale	Accuracy rating (with reference to the reference measuring range)
WWRe0-26	0 to 100°C	±0.3% ±1 digit
PR20-40	0 to 300°C	±1.5% ±1 digit
	300 to 800°C	±0.8% ±1 digit
PR5-20	0 to 100°C	±4%
	100 to 200°C	±0.5% ±1 digit
AuFe-Cr	0 to 20K	±0.5% ±1 digit
	20 to 50K	$\pm 0.3\% \pm 1$ digit
Pt-Co	4 to 20K	±0.5% ±1 digit
	20 to 50K	±0.3% ±1 digit

Reference junction compensating accuracy:

K, E, J, T, N, Platinel..... Lower than ± 0.5°C

R, S, Ni-NiMo, AuFe-Cr, WWRe5-26,

WWRe0-26, U, L ...... Lower than  $\pm$  1.0°C

A/D resolution: About 1/18000

Allowable signal source resistance:

Thermocouple input, DC voltage input

.... Lower than  $1k\Omega$  (without burnout)

Resistance thermometer input

.... Lower than  $10\Omega$  per wire (Pt100, JPt100)

Input resistance:

Thermocouple input, DC voltage input

.... About  $8M\Omega$ 

\*About 1M\Omega when a voltage divider is used.

Common mode rejection ratio: More than 130dB

Series mode rejection ratio: More than 50dB

No. of measuring points: 6 points, 12 points,

24 points

Measuring cycle: 6 points about 5sec. 12 points about 10sec, 24 points about 20sec

Temperature drift: ± 0.01% of full scale/°C (equivalent to E.M.F. for thermocouple input)

**Terminal board**: Detachable type Removable for connections

Dot-printing cycle: About 5 sec/point (when the chart speed is faster than 6mm/h)

Recording system:

Analog recording ....... Wire dot system 6-color

 $_{
m ribbon}$ 

Digital recording ....... Wire dot system 6-color

ribbon



Recording color:

Analog recording ....... Red, black blue, green, brown, purple

Digital recording

Instantaneous digital recording .....

Repetition of 6 colors (red, black, blue, green, brown, purple)

Date (year, month, day) and time printing .....
Black

Scale, point No.

Same colors as dot printing colors

Chart speed ...... Black

Setting change mark ...... Black

Recording chart:

Fan-fold type 200mm total width, 20m total length, 180mm effective recording width

Chart speed:

12.5, 25, and 50mm/h (standard)

3-speed selection by DIP switches

\*The speeds are optionally settable.

1 to 1500mm/h (1mm step)

12.5mm/h is a special example.

# Fixed time digital recording:

Time, point No., measured values, and units are printed on analog recording at every specified time interval.

Chart sp	Chart speed(mm/h)		Fixed time digital printing interval
0	to	5	Not printed
6	to	15	24 hours
16	to	25	12 hours
26	to	35	8 hours
36	to	45	6 hours
46	to	65	4 hours
66	to	85	3 hours
86	to	155	2 hours
156	to	250	1 hour
251	or	more	Not printed.

# Instantaneous digital recording:

Time, point No., measured values, and units are printed at the request time by interrupting analog recording.

#### Date and time printing:

Hour lines and time are printed on the hour sharp. Date (year, month, and day) is printed at zero hour sharp.

If this printing overlaps digital recording, time may be not printed.

\*The printing intervals depend upon the chart speeds.

Chart speed(mm/h)	Time printing	Hour line
	interval	printing interval
1	12 hours	6 hours
2	6 hours	3 hours
3	4 hours	2 hours
4	3 hours	2 hours
5 to 9	2 hours	1 hour
10 to 250	1 hour	1 hour
251 or more	Not printed	Not printed.

# Scale and point No. printing:

Point No. is printed at 6mm intervals beside the analog recording. Scales are printed sequentially every point at intervals of 48mm at 0% and 100% positions of the chart.

# Chart speed printing:

The executing chart speed is printed on the 0 % side of the chart at intervals of 84mm as well as when the power supply is turned on.

\*If digital printing is done halfway, the printing interval is extended at a high chart speed.

#### Alarm occurrence and reset printing:

Time, point No., alarm type and level are printed on the right side of the chart when an alarm occured.

Time, point No., and level are printed on the right side of the chart when the alarm was reset.

# Setting change mark printing:

A character indicating a change item is printed on the 100% side of the chart at the end of a setting change (when communication interface option is added).

# Skip function:

None of analog indications, dot-printing, digital display, and printing is done at each point.

\*If the chart speed is lower than 35mm/h, the dot-printing interval may be delayed.

Analog indications: Scale plate and scale pointer Scale plate: Max. 6 multi scale, 150 equal divisions

#### Status display:

Recording ON/OFF ... Green LED, illumination

switch

ALM ......Red LED flickers when an

alarm occured.

PRT ......Green LED lights during printing.

#### Digital display:

7-segment LED, character height 15mm

2 digits ..... Point No.

5 digits ..... Data display -9999 to 99999

#### Display items:

Multi-point sequential display, 1-point continuous display, and clock display are switched.

Setting mode display (setting, check, operation):
Digital display part is shared by key operation.
Data printing (instantaneous digital recording)
operation, chart speed setting, time setting,
alarm setting (when the alarm option is added)
data interval setting, skip setting

# Continuous indication operation:

Input entry and continuous indications at specified points only (recording stop)

#### Kinds of kevs:

REC. ON, FEED, ENTRY, ♠, SEL

# Recording operation:

REC. ON ...... Recording operation ON/OFF FEED .......... Quick chart speed

#### Rated supply voltage:

90 to 120VAC, or 180 to 240VAC (to be specified)

#### Rated supply frequency:

50Hz/60Hz (selectable by DIP switches)

Maximum power consumption: Approx. 45VA

Working temperature range: 0 to 50°C

Working humidity range:

20 to 80%RH (No condensing is allowed.)

#### Mounting position:

Forward tilting 0° Backward tilting 0 to 30° Lateral tilting 0°

#### Warm-up time: Longer than 30min

Countermeasure against power interruption:

Setting data are kept unerased by EEPROM. Clock is backed up for longer than 10 years by a lithium battery (soldering)(assuming that the

recorder is used for 8 hours a day).

#### Insulation resistance:

500VDC, higher than 20M $\Omega$  between measuring terminals and protective conductor terminal 500VDC, higher than 20M $\Omega$  between power terminals and protective conductor terminal 500VDC, higher than 20M $\Omega$  between measuring terminals and power terminals

#### Dielectric strength:

500VAC, 1min between measuring terminals and protective conductor terminal

500VAC, 1min between power terminals and protective conductor terminal

500VAC, 1min between measuring terminals and power terminals

#### Casing:

Rear casing ........ABS resin (heat-resisting temperature Max. 80°C)

Power supply ..... Steel plate

#### Color:

Door ......Black (equivalent to Munsell code N3.0)

Rear casing ..... Gray (equivalent to Munsell code N7.0)

Mounting method: Panel flush-mount

Weight:

Approx. 7.0kg

#### Transportation and storage conditions

Temperature: -20 to +60°C

Humidity: 5 to 95%RH (No condensing)

Vibrations: 10 to 60Hz 0.5G

Shock: Less than 40G



This also offers the following maintenance functions. However these functions are performed by IBM-PC at CHINO's agents, world wide.

• ENG1 mode (Specifications check)

Input parameters(ranges, scales, units)

Alarm(mode, output destinations, AND/OR \*when an alarm option is provided.)

Recording colors

Key lock(Key lock condition check by means of communication)

• **ENG2 mode** (Communication option setting and external drive option output specifications check)

Communication setting (addresses, baud rates, character configuration)

External drive information

#### · Calibration

Indications are calibrated on every channel. Indication are shifted on every channel. Chart scale position is corrected.

· Memory clear

Initialization of set values (Input types, ranges, scales, units, and chart speeds are reset to the set values at the delivery time from the works, and alarm is initialized to no setting)

Clock is initialized to Jan. 1, 1994.

Calibration data are initialized.

#### · Hardware check

Printer check, indicator check, DIP switch check, external drive check, version check, and alarm output contact check

#### **OPTIONS**

n   C   3   p   N   3   r   C	The following operation can be done by external contact signals.  Deparation type: 3-chart speed selection, recording stop, & data printing  No. of contact points: 3 no-voltage contacts + 1 point (for a special request)  Contact capacity: 12V DC, 2mA or higher  * The depth is increased by 16mm when this option is added.

Option name	Description
	One of RS-232C, RS-422A, and RS-485
tion interface	is to be specified.
non interiese	Communication contents:
	Transmission of measured values and sta-
	tus information.
	Setting and confirmation of parameters are
	settable by keys.
	*The depth is increased by 16mm when this
	option is added.
Alarm output	No. of output points: 6 points
(6P)	Alarm type: Absolute value alarm, OR output
	*Differential alarm, change ratio alarm,
	standby alarm and AND output can be of-
	fered on request.
	Setting level: 2 levels/channels
	Contact capacity:
	Mechanical relay: 100V AC, 0.5A, (Resistive
	load)
	Mechanical relay output (Common to "a" contact and "c" contact)
	: 240V AC, 0.2A, (Resistive load)
	MOS relay output: 240V (AC, DC), 50mA
	(Resistive load)
	The depth is increased by 16mm when this
	option is added.
	And the depth in increased by 27mm when
	mechanical relay "a" contact is added.
Extended	Alarm contact outputs of 12 points and 24
alarm output	points together with alarm output (6P)
High-speed	Dot-printing cycle About 2.5sec/dot
dot-printing	(when the chart speed is more than 12mm/h)
. 3	*The dot printing cycle deffers according to
	the chart speed when the chart speed is less
	than 2mm/h.
High voltage	Voltage-dividing resistor is built in.
input	Higher than 5VDC, but lower than 60VDC
	(channel fixed).
Current	A resistor is built in. Lower than 50mA
input	(channel fixed, the resistor is externally
	mounted).
Burnout	The pointer overshoots the high limit when in-
	put signals are interruputed.
	(except for voltage-dividing inputs, voltage/cur-
	rent inputs)
	Thermocouple input: Channels are fixed.
	Resistance thermometer input;
B 4 .1	All channels are fixed.
Math	One of addition • substruction • multiplication,
function	square root, logarithm (common, natural), tem-
	perature humidity, integration is to be speci- fied.
	· · · · · · · · · · · · · · · · · · ·
CE-marking	• Standards
	EN55011 Group 1 class A
<u> </u>	EN50082-2 (industrial environment) EN61010-1 + A2
	• Rated supply voltage
<u> </u>	100 to 240VAC
! 	• Case
	Steel plate (add 1kg weight to standard
	model)
	• Reference junction compensation stability
	±5°C under EMC test environment

# **■ REFERENCE MEASURING RANGES**

		Reference				Indicat	ling	Min.mea-
Input type		measuring	Scale		resolut		suring	
		range	<u> </u>				range	
		± 7mV	- 7	to	+ 7mV	1	μV	3. 2mV
		±14mV	-14	to	+14mV	10	u, V	6. 3mV
DC	voltage	± 25mV	-25	to	+25mV	10	μV	11.3mV
		± 70mV	-70	to	+70mV	10	μV	31.5mV
		± 5V	- 5	to	+ 5 V	1	mΨ	2. 3V
		± 7mV	-150	to	+150 ℃	n	1°C	100℃
		± 14mV	-200		+300 ℃		ič	200℃
	K	± 25mV	-200		+600 ℃		iα	400°C
		± 70mV	-200	to	+1370°C	ų,	iε	800°C
					+350 °C	Λ.	1°C	200℃
	E	士 25mV	-200			U.		
		±70mV	-200		+900 °C		<u> </u>	500°C
	1	± 25mV	-200		+450 °C			300°C
		±70mV			+1200°C		1°C	600°C
	_	± 7mV	-150		+150 °C		1°C	100°C
	Τ	±14mV	-200		+250 °C		1°C	200℃
		±25mV	-200		+400 ℃	U.	1°C	300℃
	R	±25mV	0		+1760℃		1℃	1200℃
	S	±25mV	0	10	+1760℃		۱°C	1200℃
	В	上 14mV	400	to	+1820℃		1°C	1200°C
		± 7mV	0	to	+200 ℃		۱°C	150℃
-e		± 14mV	ő		+350 ℃		iε	300℃
Ω.	N	± 25mV	ő		+700 ℃		ic	400℃
22		± 70mV	0		+1300℃		ľČ	900°C
ermocouple	W000 5 60	!				<del></del>	i°C	
The	₩WRe5-26	±70mV	0	to	+2320°C			1900℃
ļ	W#Re0-26	±70mV	0	and the factors	+2320℃		1°C	1900°C
	PR20-40	± 7mV	0		+1880°C		1°C	1500℃
	PR5-20	±14mV	0	to	+1880℃		1°C	1200°C
	Ni-NiMo	±70mV	0	to	+1310℃		1°C	700℃
	AuFe-Cr	± 7mV	0	to	300K	0	. 1K	180K
		± 7mV	-100	l n	+150 ℃		1°C	100℃
	Platinel	± 14mV	-100		+300 ℃		ič	200℃
		± 25mV	-100		+600 ℃		ič	400℃
		± 70mV	-100	to	+1390°C		ίč	800℃
								$\overline{}$
		± 7mV			+150 ℃		1°C	100℃
	U	±14mV			+250 °C		1°C	200℃
1	-	士 25mV		to	+450 °C	U.	1°C	300℃
		±70mV		to	+600 ℃		1°C	600℃
	L	±25mV			+450 ℃	0,	1°C	300℃
	<b>L</b>	± 70mV	-200		+900 ℃		1°C	600℃
		120 Ω	- 50	to	+ 50 ℃		1°C	50°C
<u>د</u>		140 Ω	-100		+100 ℃		1°C	100℃
ده	Pt100	160 Ω	-140	ťο	+150 ℃		1°C	150℃
		220 Ω	-200		+300 ℃		۱°C	200℃
thermometer		340 Ω	-200	to	+649 ℃	0.	1°C	400°C
E		120 Ω	- 50	to	+ 50 °C	0.	1°C	50°C
ì		140 Ω	-100		+100 ℃		1°C	100℃
n C	JPt100	160 Ω	-140		+150 ℃	0.	ľC	150°C
stance		220 Ω	-200		+300 ℃		1°C	200℃
		340 Ω	-200		+649 ℃		1°C	400°C
Resi	Old Pt50	220 Ω	-200	to	+649 ℃	l	1°C	300℃
Chi	Pt-Co	220 Ω	4	to	374K		). 1K	200K
J		72032	<del>4</del>	LU	3141/	L	t. 11X	Look

- \* Caution) The minimum measuring ranges of the temperature scale are reference values. (They vary more or less according to the temperature ranges.)
- \* Select the combinations of input scales out of the following four kinds in case of the scales by points.
- 1. Thermocouple, DC voltage type 1 : 7mV, 14mV, 25mV, 5V 2. Thermocouple, DC voltage type 2 : 14mV, 25mV, 70mV, 5V 3. Resistance thermometer, 5V type 1:  $120\,\Omega$ ,  $140\,\Omega$ ,  $160\,\Omega$ , 5V
- 4. Resistance thermometer, 5V type 2:  $160\,\Omega$  ,220  $\Omega$  ,340  $\Omega$  ,5V

# **■ STANDARD SCALES**

		Working	
l n	put type	Working reference measuring range	Standard scale
	DC oltage/ urrenty	士 7mV 士 14mV 士 25mV 士 70mV 士 5V	- 5 to + 5mV, 0 to 5mV -10 to +10mV, 0 to 10mV 0 to 20mV 0 to 50mV 1 to 5V, 4 to 20mA, 10 to 50mA
		± 7mV	(The scale plate is equally divided into 0 to 100 divisions)  □ to 100 ℃, □ to 150 ℃
	V	± 14mV	-50 to +100 ℃, -50 to +150 ℃ -100 to +50 ℃ 0 to 200 ℃, 0 to 250 ℃, 0 to 300 ℃
	К	士25mV 士70mV	-50 to +200°C, -100 to +200°C 0 to 400°C, 0 to 500°C, 0 to 600°C 0 to 800°C, 0 to 1000°C.
		± 1 UAI¥	0 to 1200 °C
	E	± 25mV	0 to 200℃, 0 to 300℃ -50 to +150℃ 0 to 500℃, 0 to 600℃, 0 to 800℃
		士 25mV	0 to 300°C. 0 to 400°C
	J		0 to 600°C, 0 to 800°C, 0 to 1000°C 0 to 1200°C
		± 7mV	0 to 100°C, 0 to 150°C  -50 to +100°C, -50 to +150°C
	Т	±14mV	-100 to +50°C 0 to 200°C, 0 to 250°C
		±25mV	-50 to +200 ℃, -100 to +200 ℃ 0 to 300 ℃, 0 to 400 ℃
	R	±25mV	0 to 1200°C, 0 to 1400°C 0 to 1600°C, 400 to 1600°C
<u>ම</u>	S	±25mV	0 to 1400°C, 0 to 1600°C 400 to 1600°C
Thermocouple	В	土 14mV	0 to 1200°C, 0 to 1400°C 0 to 1600°C, 0 to 1800°C 400 to 1600°C
Therm	N	士 7mV 士14mV 士25mV	0 to 400°C, 0 to 500°C, 0 to 500°C
	PR20-40	±70mV ± 7mV	
	PR5-20	土 100V 土 14mV	0 to 1200°C. 0 to 1460°C
	Ni-NiMo	± 70mV	0 to 1600°C 0 to 800°C, 0 to 1000°C
	141 141110		0 to 1200°C 0 to 100°C, 0 to 150°C
	Platinel	±14mV	-50 to +100 ℃, -50 to +150 ℃
	reatiner	± 25mV ± 70mV	0 to 400°C, 0 to 500°C, 0 to 600°C 0 to 800°C, 0 to 1000°C, 0 to 1200°C
		± 7mV	0 to 100°C. O to 150°C
	U	±14mV	-50 to +100 ℃, -50 to +150 ℃, 0 to 200 ℃, 0 to 250 ℃ -50 to +200 ℃
		土 25mV 土 70mV	-100 to +200 ℃ 0 to 300 ℃, 0 to 490 ℃ 0 to 600 ℃
	L	±25mV	0 to 300°C, 0 to 400°C
_		±70mV 120Ω	0 to 600°C, 0 to 800°C
er		140 Ω	0 to +100°C, −20 to +80°C −100 to +50°C, −50 to +100°C
thermometer	Pt100	160 Ω 220 Ω	50 to 100°C, -40 to +80°C
ner		340 Ω	-50 to +250 ℃, -100 to +200 ℃ 0 to 400 ℃, 0 to 500 ℃, 0 to 600 ℃
		120 Ω	-50 to +50°C, 0 to 50°C
Resistance		140Ω	0 to 100°C, -20 to +80°C  -100 to +50°C, -50 to +100°C
Sis	JPt100	160 Ω	50 to 100°C, -40 to +80°C 0 to 150°C, -50 to +150°C
Re		220 Ω	0 to 200°C, 0 to 250°C, 0 to 300°C -50 to +250°C, -100 to +200°C 0 to 400°C, 0 to 500°C, 0 to 600°C
L_	l	340 Ω	U to 400 C, U to 300 C, U to 500 C



# **M** ACCESSORIES


Name of accessories	Q'ty	Remarks
Recording chart	1 pad	Fan-fold type, 20m in total length
Mounting bracket	2 pcs.	Used for panel mounting.
Channel indicating	1 sheet	Attached to the door for describing
card		the measuring titles of individual chan-
		nels (The functions of DIP switches
		are described on the rear panel).
Ribbon cassette	1 pc.	6-color ink ribbon for analogue and
		digital recording
Auxiliary terminal	5 pcs.	Use these input (alarm) terminal
screw		screws if they are missing (3.5mm in
		thread diameter).
Lubricating oil	1 bottle	Contains 10cc.
Instruction manual	1 pad	
Inspection	1 sheet	Delivary inspection certificate
certificate		

#### **CONSUMABLES**

Article names	Sales unit
Recording chart	15 pads/case
6-color ink ribbon cassette	1 pc/case
Lubricating oil	1 bottle
Mounting bracket	2 pcs. (for one unit)

Panel Cutout/Minimum Instrument mounting space

#### **M** TERMINAL BOARD

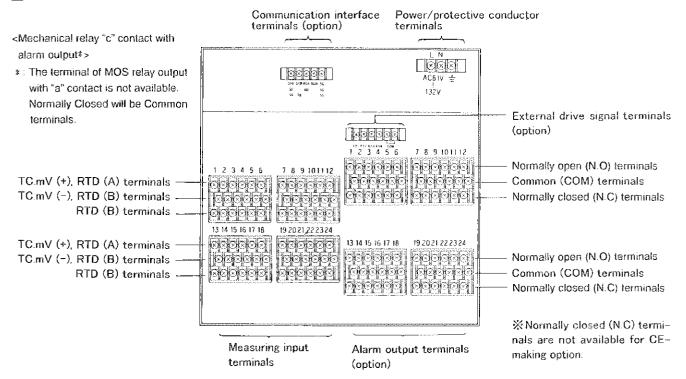

#### **EXTERNAL DIMENSIONS**

# \* 211mm (for external drive, alarm output and communication interface) 222mm (for mechanical relay "a" contact output)



### HOW TO ORDER

1. Model  $: \mathbf{B} \mathbf{H} \cap \Box \Box \Box \Box \mathbf{D} \Box$ 

2. Power source: 100VAC line or 200VAC line

(To be specified)

\*No need to specify the above for CE-marking (100 to 240VAC free power source)

3. Chart speed: Standard 12.5, 25, 50mm/h

Specified

mm/h

4. Input type and scale

	ype and a		
Point No.	Input type	Scale range	Printing unit
	<u> </u>	(incl.deci.point)	
		to	
	-	to	
		to	-
		to	
	<del></del>	to	
		to	

#### Example

	Point Na	Input type	Scale range	Printing unit	
ľ	1-3	K	0.0 to 400.0	°C	

Printing unit is 2 digits. (C shows 2 digits.) Shunt resistor for current input:

Built-in or external

#### 5. Scale Plate:

	Scale range	Unit
1.		
2.		
3.		
4.		
5.		
6.		

Maximum 6 multi scale

Unit: Max. 10 characters (Single scale) Max. 6 characters (Multi scale)

#### 6. Alarm option:

Alarm designation: Standard □, Exclusive□

- \* In case exclusive is specified, write exclusive specifications in the right table
- \* Parenthesized ( ) settings show the standard settings.
- \* Enter alarm set values by keys.
- \* Alarm output is up to 2 levels per channel.
- Alarm type: H; High limit absolute value alarm, L; Low limit absolute value alarm, B; Differencial high limit alarm, S; Differencial low limit alarm, U; Change ratio increase limit alarm, D; Change ratio decrease limit alarm These alarms are settable. Fill the option parameters

with a reference channel when the differential alarm is selected, or fill the option parameter with scanning cycle (1 to 9) when the change ratio alarm is selected.

Add W to the alarm type, if a standy alarm is necessary.

(Example: WH, WL)

An alarm output AND connection is possible. Write in the option parameters.

OR output: Alarm output is executed when one of alarm points becomes alarm condition.

AND output: Alarm output is executed when all alarm points become alarm condition.

Alarm output numbers are freely settable. Example: 24-point alarm outputs are possible on 12-point instrument, (when using extended alarm output 24 points).

Points	Level	Alarm type	Output No	Alarm set value	Para- meters
1	1	(H)	(1)		
' [	2	(L)	(1)	Ì	
2	1	(H)	(2)		
	2	(L)	(2)		
3	1	(H)	(3)		
	2	(L)	(3)		-
4	1	(H)	(4)		
	2	(L)	(4)		
5	1	(H)	(5)		
	2	(L)	(5)		
6	1	(H)	(6)	1	
	2	(L)	(6)		
7	1	(H)	(7)		***************************************
	2	(L)	(7)		
8	1	(H)	(8)		
	2	(L)	(8)		
	1	(H)	(9)		
9 -	2	(L)	(9)		
	1	(H)	(10)		··
10	2	(L)	(10)		
	1	(H)	(11)		
11	2	(L)	(11)		
	1	(H)	(12)	<del> </del>	
12	2	(L)	(12)		*
13	1	(H)	(13)	1	
	2	(L)	(13)		
14	1	(H)	(14)		
	2	(L)	(14)	T	
15	1	(H)	(15)		
	2	(L)	(15)		
16	1	(H)	(16)		
	2	(L)	(16)		
17	1	(H)	(17)		
	2	(L)	(17)	1	
	1	(H)	(18)	<del> </del> -	
18	2	(L)	(18)	<u> </u>	
	1	(H)	(19)		
19	2	(L)	(19)		
00	1	(H)	(20)		
20	2	(L)	(20)	1	
7,	1	(H)	(21)		
21	2	(L)	(21)	†	
20	1	(H)	(22)	<del> </del>	
22	2	(L)	(22)		
23	1	(H)	(23)	ţ	
	2	(L)	(23)		
		(H)	(24)	<u> </u>	
24	2	(L)	(24)	<del> </del>	

Specifications subject to change without notice. Printed in Japan (1) 2000. 6

#### CHINO CORPORATION

32-8, KUMANO-CHO, ITABASHI-KU, TOKYO 173-8632 Telephone: +81-3-3956-2171 Facsimile :+81-3-3956-0915 E-mail: chinojpn@mb.infoweb.ne.jp

Website: http://www.chino.co.jp/